

Work Order ID 157102

Monday, February 13, 2017 1:06:44 PM

157102

Page 1

Item ID: D3391-023

Ship Alone Accept***N900040100***Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Mid Tube Assembly

Start Date: 2/13/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 3/10/2017 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: *MF* Date: *17-2-13* Tooling:

Date:

QC: Date: SPC (Y/N):

Date:

Run Start ***NR1***Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D3391	J								

100

0.00

100

Skidtubes

Skidtubes

Skidtubes

Memo

0.21

1-Cut tube to finish length as per Dwg D3391

2-Drill pilot holes using DT8796 (Do not drill "B" holes) and drill only 1 fwd saddle hole on one side only as per Dwg D3391

3-Open saddles and GHW holes to Ø0.4375" except for fwd saddle hole of detail "J"

4-Remove .030" from Fwd indexing Ridge as per Dwg D3391

5-Remove indexing ridge on Fwd & Aft end of skidtube as per Dwg D3391

6-Deburr, scribe batch # on aft end.

7- Locate D3391-021 in D3391-023 at 9.00" (see view z-z)

8- Transfer drill one fwd saddle hole only to .188" dia, transfer drill all remaining fwd saddle holes using DT 8149 locating from previously drill .188" dia hole, using t-pins and clicos to ensure perfect allingment, open up previously tranfer drilled pilot holes in D3391-023/-021 using drill press.

ON FIRST SIDE ONLY drill out 2nd and forth fwd saddles holes to 0.500" as per

D3391-021 BATCH: *17-2-14*

D3391-021 BATCH:

B157102

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																											
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval																																																							
Description Work Order Deviation				Disposition				Completed By																																																							
								Lead hand / Supervisor Approval Verification																																																							
								QC / QA Coordinator Approval																																																							
Root Cause		FAULT CATEGORY																																																													
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER :	
Misidentified ☐	Past Due ☐																																																														

Work Order ID 157102

Monday, February 13, 2017 1:06:44 PM

157102

Page 2

Item ID: D3391-023 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Mid Tube Assembly
 Start Date: 2/13/2017 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 3/10/2017 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
	9- Drill #30 pilot holes using wearplate Jig DT8217 Identify Ø0.375" holes with paint marker, ***DO NOT DRILL HOLES #3-19-20 FROM FWD END OF JIG*** Locating from two fwd wearplate holes in D3391-023 drill remaining 6 wearplate holes in D3391-021 using DT8937 10- Open wearplate holes of D3391-023 assembly detail section G-G to Ø0.375" (10 holes) as per Dwg D3391 Open wearplate holes of D3391-023 assembly detail section H-H to Ø0.297" (20 holes) as per Dwg D3391 Deburr and blow out all chips from inside tube, scribe batch # in D3391-023 at aft end - Open Fwd Saddle holes. V/A 11- Open 10 wearplate holes in D3391-021 to 0.297" dia. 12- DEBURR AND BLOW OUT CHIPS	DP 17-2-21							17-02-21 DT
110	QC5- Inspect part completeness to step on W/O	0.00							
110									
QC	Memo	0.00							
Quality Control									

DAS
38
2-89
FEB 22 2017

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QS1042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabelled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					

Work Order ID 157102

Monday, February 13, 2017 1:06:44 PM

157102

Page 3

Item ID: D3391-023

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Mid Tube Assembly

Start Date: 2/13/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 3/10/2017 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120	Chemical Conversion Coat per QSI005 4.1	0.00							
120									
HandFinish	Memo	0.04							
Hand Finishing									
130	QC7-Inspect Chemical Conversion Coat	0.00							
130									
QC	Memo	0.00							
Quality Control									

(X1) 0 2017/02/23
BEB

DD 17-2-23

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

Work Order ID 157102

Monday, February 13, 2017 1:06:44 PM

157102

Page 4

Item ID: D3391-023 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Mid Tube Assembly
Start Date: 2/13/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 3/10/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140	Skidtubes	0.00							
140									
Skidtubes	Memo	0.09							
Skidtubes	1-Open float bag holes as per dwg 2-C'sink float bag holes as per dwg 3- Prepare tube for welding 4-Bond web in place as per Dwg D3391 & QSI 015. Adhere for 12 hours) A/R Sikaflex exp: <u>12-12-7</u> batch#: <u>1136652</u> NOTE:ENSURE WEB IS INSERTED IN AFT END OF TUBE								
150	QC5- Inspect part completeness to step on W/O	0.00							
150									
QC	Memo	0.00							
Quality Control									

Handwritten: 12-2-23

Handwritten: 1 8 1702-27

Handwritten: DAS 18 9-99

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER :					

Monday, February 13, 2017 1:06:44 PM

Page 5

[illegible]

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					

Work Order ID 157102

Monday, February 13, 2017 1:06:44 PM

157102

Page 6

Item ID: D3391-023

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Mid Tube Assembly

Start Date: 2/13/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 3/10/2017 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start

NR1

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
185	Pressure Wash per QSI005 4.3	0.00							
185									
HandFinish	Memo	0.07							
Hand Finishing	AND REALODINE AS PER PAR09-043								20170302 BFB
190		0.00							
190									
SprayPaint	Memo	0.33							
Spray Painting	PRIME AS PER DWG AND QSI005 4.2.1.3.3 PRIMER BATCH: <u>136429</u>								17-03-05
	PAINT AS PER DWG AND QSI005 4.2.2.4 PAINT: <u>136731</u>								
200	QC14- Inspect Spray Paint	0.00							
200									
QC	Memo	0.00							
Quality Control									17/03/08 DAS 15 9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Work Order ID 157102

Monday, February 13, 2017 1:06:44 PM

157102

Page 7

Item ID: D3391-023

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Mid Tube Assembly

Start Date: 2/13/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 3/10/2017 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
230	HandFinishing	0.00							
230									
HandFinish	Memo	0.10							
Hand Finishing	1-Install Inserts as per Dwg								
240	QC5- Inspect part completeness to step on W/O	0.00							
240									
QC	Memo	0.00							
Quality Control									
250	Identify as per dwg & Stock Location: _____	0.00							
250									
Packaging	Memo	0.05							
Packaging									

12 d 20 17/03/18

DAS
38
9-89
MAR 09 2017

DAS 27 9-89 DAS 28 9-89

MAR 09 2017

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width: 100%; border: none;"> <tr> <td style="width: 15%;">Skid-tube ☐</td> <td style="width: 15%;">Cross tube ☐</td> <td style="width: 15%;">Water Jet ☐</td> <td style="width: 15%;">Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																		
Description Work Order Deviation				Disposition				Completed By																	
								Lead hand / Supervisor Approval Verification																	
								QC / QA Coordinator Approval																	
Root Cause		FAULT CATEGORY																							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐																				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐																				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐																				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐																				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐																				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER :																							
Misidentified ☐	Past Due ☐																								

Work Order ID 157102

Monday, February 13, 2017 1:06:44 PM

157102

Page 8

Item ID: D3391-023

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Mid Tube Assembly

Start Date: 2/13/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 3/10/2017 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

260

QC21- Final Inspection - Work Order Release

0.00

260

QC

Memo

0.00

Quality Control

DAS
21
9-89

MAR 09 2017

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
								Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	

Root Cause			FAULT CATEGORY								
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong	☐
Design	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions	☐
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance	☐
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect	☐
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing	☐
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved	☐
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing	☐
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish	☐
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread	☐
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence	☐
Past Expiry Date	☐	Manufacturing Process	☐	OTHER : _____							
Misidentified	☐	Past Due	☐								

Picklist Print

Monday, February 13, 2017 1:06:44 PM

Page 1

Work Order ID: 157102

157102

Parent Item: D3391-023

D3391-023

Parent Item Name: Mid Tube Assembly

Start Date: 2/13/2017

Required Date: 3/10/2017

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP A05.10.20New Issue KJ/EC
 IPP B06.02.10ECN773 dwg rev.D EC
 IPP C 07.03.20 rev F dwg EC
 IPP D 07.03.28 re-format EC
 IPP E 07.10.31 ecn 1053P EC
 IPP Rev:F ECN 1056 07-11-13 DD verified by: EC
 IPP Rev:G 08-09-08 new process (ecn 08-510) DD verified by:EC
 IPP Rev:H 08-09-10 revH as per dwg DD verified by:EC
 IPP Rev: I 08-11-13 Removed steps per w/o, QC KJ verified by: ec IPP
 Rev:J add in seq 140 expire date &b# sikaflex DD 10.02.17 verified by:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D2500-1-100		Manufactured	No				Each	43.0000		1			
D2500-1-100									**				
Skidtube Extrusion													
				<u>Location</u>				<u>Loc Qty</u>		<u>Loc Code</u>			
				HALL				43					
				133815				43					
D3591-1		Manufactured	No				Each	35.0000		2			
D3591-1									**				
Bushing													
				<u>Location</u>				<u>Loc Qty</u>		<u>Loc Code</u>			
				FG				10					
				115645				4					
				92873				6					
				FP001				25					
				134643				9					
				141636				6					
				149167				3					
				153743				7					

DAS
27
9-89

17-02-14
DT

B/S/K/46 X2
DAS
28
9-89

MAR 09 2017

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS					
				Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐		
				Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐		
				Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐		
				Large Fab ☐	Composite ☐	Supplier ☐			
Date : _____		Step #: _____			QTY Effective : _____		MRB (QS1042) Approval		
Description Work Order Deviation				Disposition					
				Completed By					
				Lead hand / Supervisor Approval Verification					
				QC / QA Coordinator Approval					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Picklist Print

Monday, February 13, 2017 1:06:44 PM

Page 2

Work Order ID: 157102

157102

Parent Item: D3391-023

D3391-023

Parent Item Name: Mid Tube Assembly

Start Date: 2/13/2017

Required Date: 3/10/2017

Start Qty: 1.00

Required Qty: 1.00

D3389-1 Manufactured No

140 Each

5.0000

1

1

D3389-1

Web

**

17-2-23

Location

Loc Qty

Loc Code

LG002

5

154066

5

160

Each

170.0000

5

5

**

17-02-27

D3681-1 Manufactured No

D3681-1

Spacer

Location

Loc Qty

Loc Code

LG001

170

145956

1

151967

4

153806

38

155381

63

155806

64

230

Each

5,252.000

20

20

**

17-02-08

ALS4-1032-130 AELS4-1032-130 Purchased No

ALS4-1032-130

Rivnut

Location

Loc Qty

Loc Code

CCK007

4950

M136579

4950

FG

50

FG

M135442

50

FP001

252

M133077

72

M135442

180

X20

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QS1042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER :					

D3391-041/-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY -041	QTY -043	PART NUMBER	DESCRIPTION
X	X	D3391-041	FLOAT SKIDTUBE ASSEMBLY
		D3391-043	FLOAT SKIDTUBE ASSEMBLY
1		D3391-011	FWD TUBE ASSEMBLY
1		D3391-013	MID TUBE ASSEMBLY
1		D3391-015	AFT TUBE ASSEMBLY
	1	D3391-021	FWD TUBE ASSEMBLY
	1	D3391-023	MID TUBE ASSEMBLY
	1	D3391-025	AFT TUBE ASSEMBLY
2	2	D3591-1	BUSHING
4		D3672-3	WASHER
1	1	D4095-041	WEARSHOE
1	1	D4095-043	WEARSHOE
1	1	D4095-045	WEARSHOE
1	1	D4095-047	WEARPAD
1	1	D4095-049	WEARPAD
1	1	D4095-051	WEARSHOE
24	24	AN3C4A	BOLT
4	4	AN3C8A	BOLT
10	10	AN5C7A	BOLT
28	28	NAS1149C0332R	WASHER
10	10	NAS1149C0532R	WASHER
4		MS27039C4-12	SCREW
4		NAS1149C0432R	WASHER

J

mf
157109

RELEASED
2016-04-28
Ecn 16-96

J	INCORPORATED DSI 9733, REFORMAT DRAWING CHANGED CBORE DEPTH (ZN D2-8, D2-9), REVISED TABLES, REPLACED POWDER COAT WITH PAINT	ML	16.01.14
I	REMOVE GASKETS AND REPLACE ALL WEARSHOES; PARTS LIST UPDATE, ZN A8-1, ZN A8-2, ZN A6-4, ZN B6-8; LPS-3 COATING REMOVED FROM NOTE 2, ZN A3-1, ZN A3-2, REMOVED INSERT AELS-1032-130, ZN B6-4, B2-4, C7-8, C3-8; REMOVED HOLES, ZN D6-4 ZN D2-4, ZN D7-8, ZN D3-8	XDF	11.10.13
H	DRAWING UPDATED TO CURRENT STANDARDS. SHT 1 PL ADDED D3591-1 BUSHING. ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. SHT 2 PL ADDED D3591-1 BUSHING. ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. (FOR FURTHER INFO SEE DSI 9364 & NCR 08-074)	AJS	08.08.20
G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	06.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07
REV	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE USA, INC EUGENE, OR	
DRAWN	ML		
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.	LP	D3391	SHEET 1 OF 11
APPROVED	BA	TITLE	SCALE
DE APPR.	BA	412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					

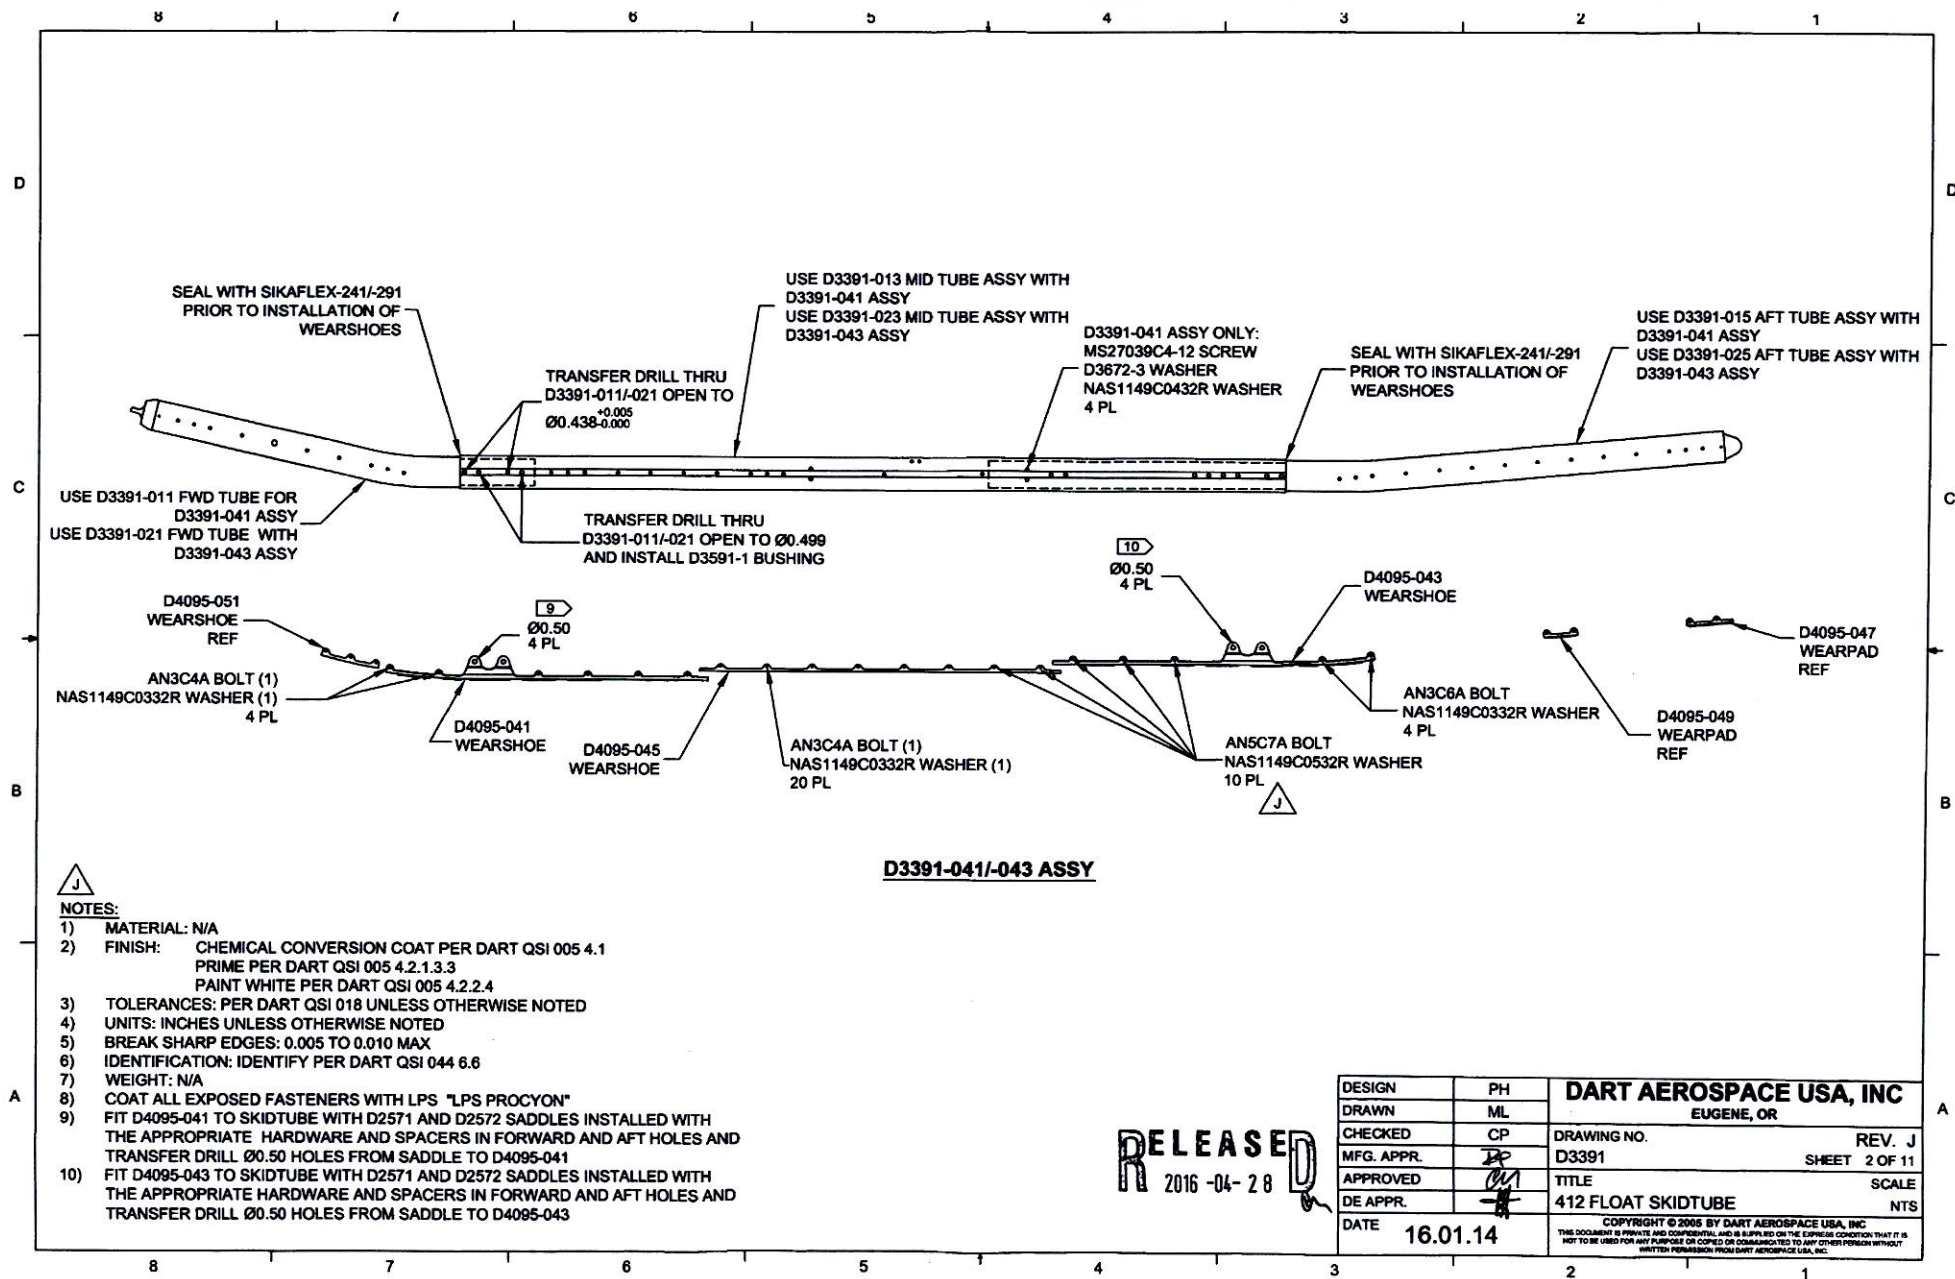

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐								
		OTHER : _____							

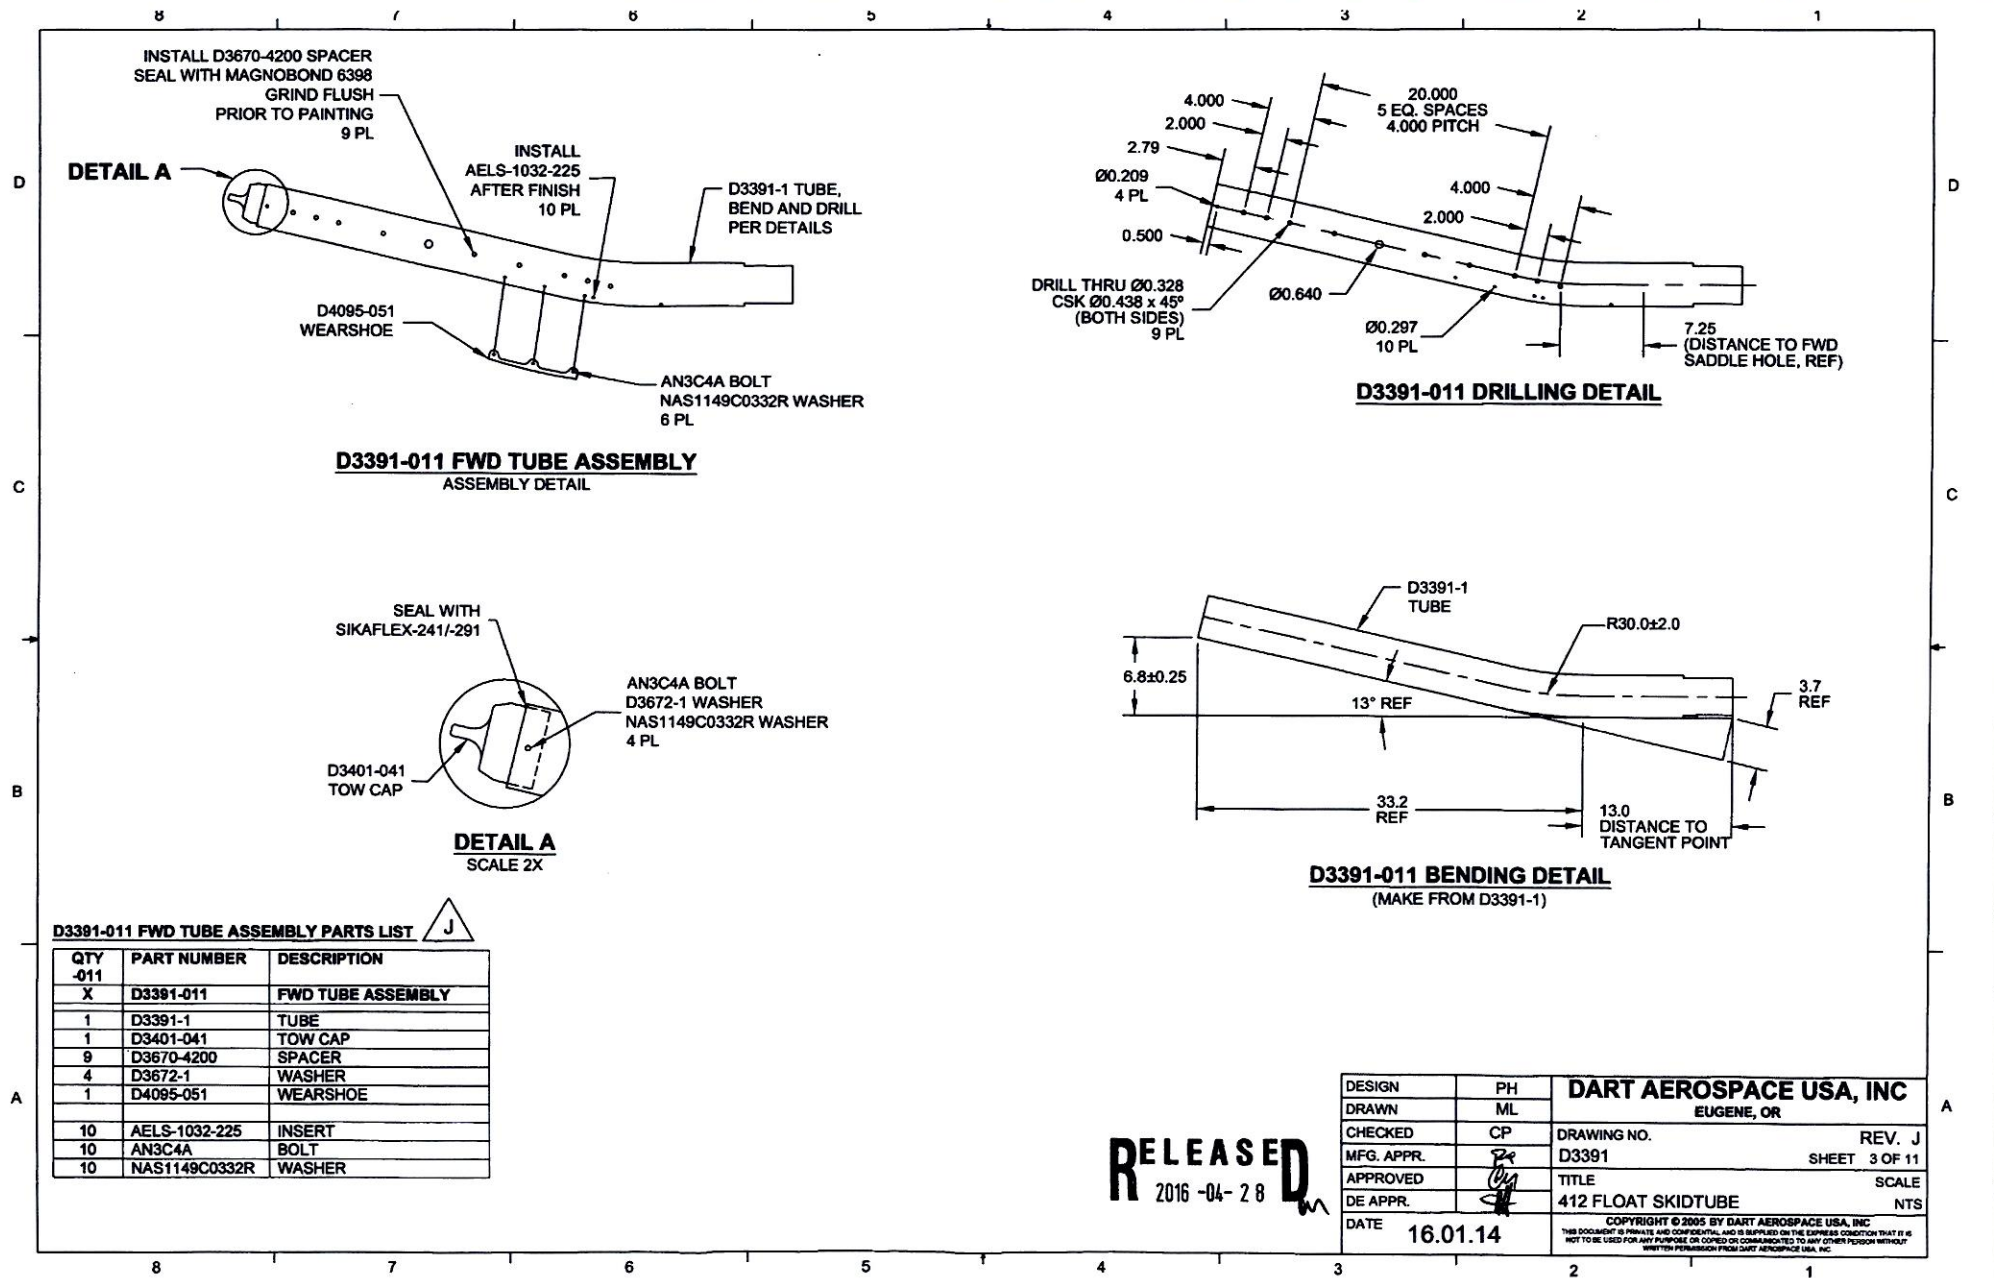

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

INSTALL D3670-4200 SPACER
SEAL WITH MAGNOBOND 6398
GRIND FLUSH
PRIOR TO PAINTING
4 PL

DETAIL B



D4095-051
WEARSHOE

INSTALL
AELS-1032-225
AFTER FINISH
10 PL

AN3C4A BOLT
NAS1149C0332R WASHER
6 PL


D3391-021 FWD TUBE ASSEMBLY ASSEMBLY DETAIL

SEAL WITH
SIKAFLEX-241/-291


D3401-041
TOW CAP

DETAIL B SCALE 2X

AN3C4A BOLT
D3672-1 WASHER
NAS1149C0332R WASHER
4 PL

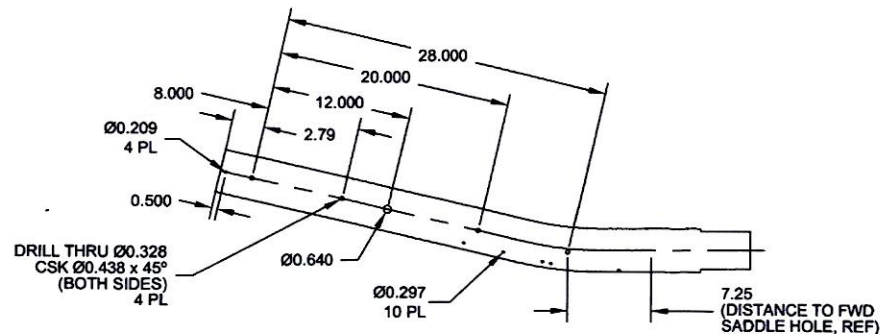

D3391-021 DRILLING DETAIL

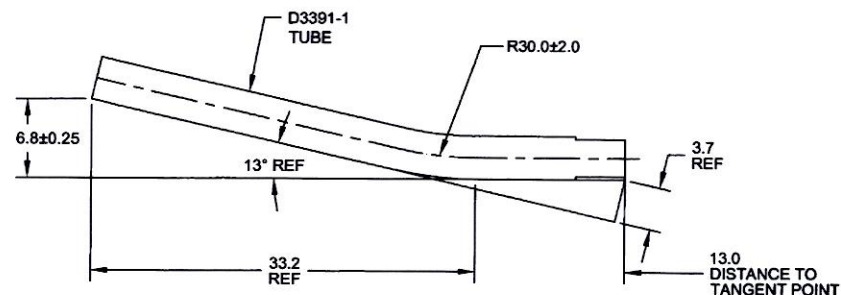

D3391-021 BENDING DETAIL (MAKE FROM D3391-1)

D3391-021 FWD TUBE ASSEMBLY PARTS LIST

QTY -021	PART NUMBER	DESCRIPTION
X	D3391-021	FWD TUBE ASSEMBLY
1	D3391-1	TUBE
1	D3401-041	TOW CAP
4	D3670-4200	SPACER
4	D3672-1	WASHER
1	D4095-051	WEARSHOE
10	AELS-1032-225	INSERT
10	AN3C4A	BOLT
10	NAS1149C0332R	WASHER

DESIGN	PH	DART AEROSPACE USA, INC EUGENE, OR	
DRAWN	ML		
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.	TS	D3391	SHEET 4 OF 11
APPROVED	TS	TITLE	SCALE
DE APPR.	TS	412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

RELEASED
2016-04-28

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

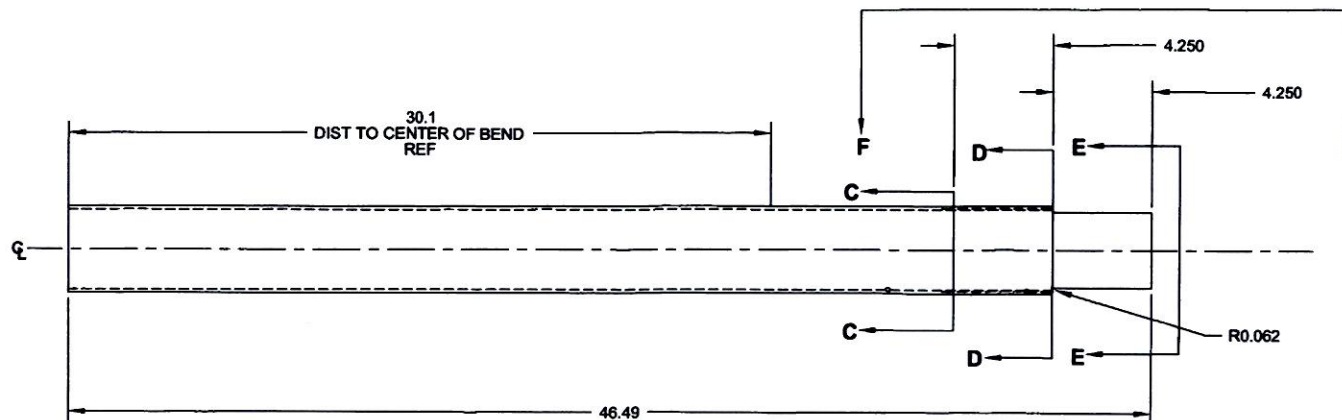


D3391-1 TUBE
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

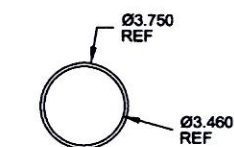


SECTION C-C

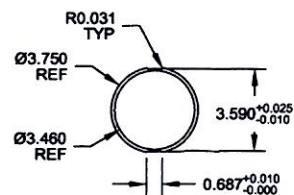

SECTION D-D

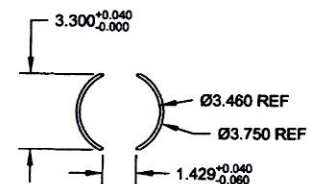

SECTION E-E

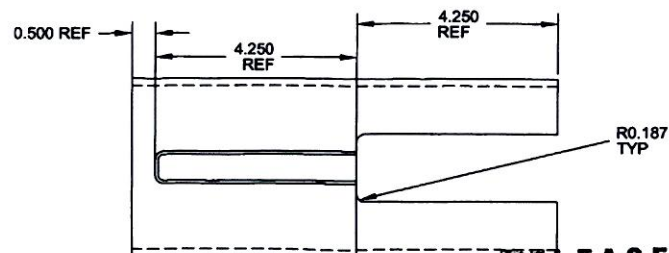

VIEW F-F
SCALE 2X

RELEASED
2016-04-28

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.	<i>CP</i>	D3391	SHEET 5 OF 11
APPROVED	<i>CP</i>	TITLE	SCALE
DE APPR.	<i>CP</i>	412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2006 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

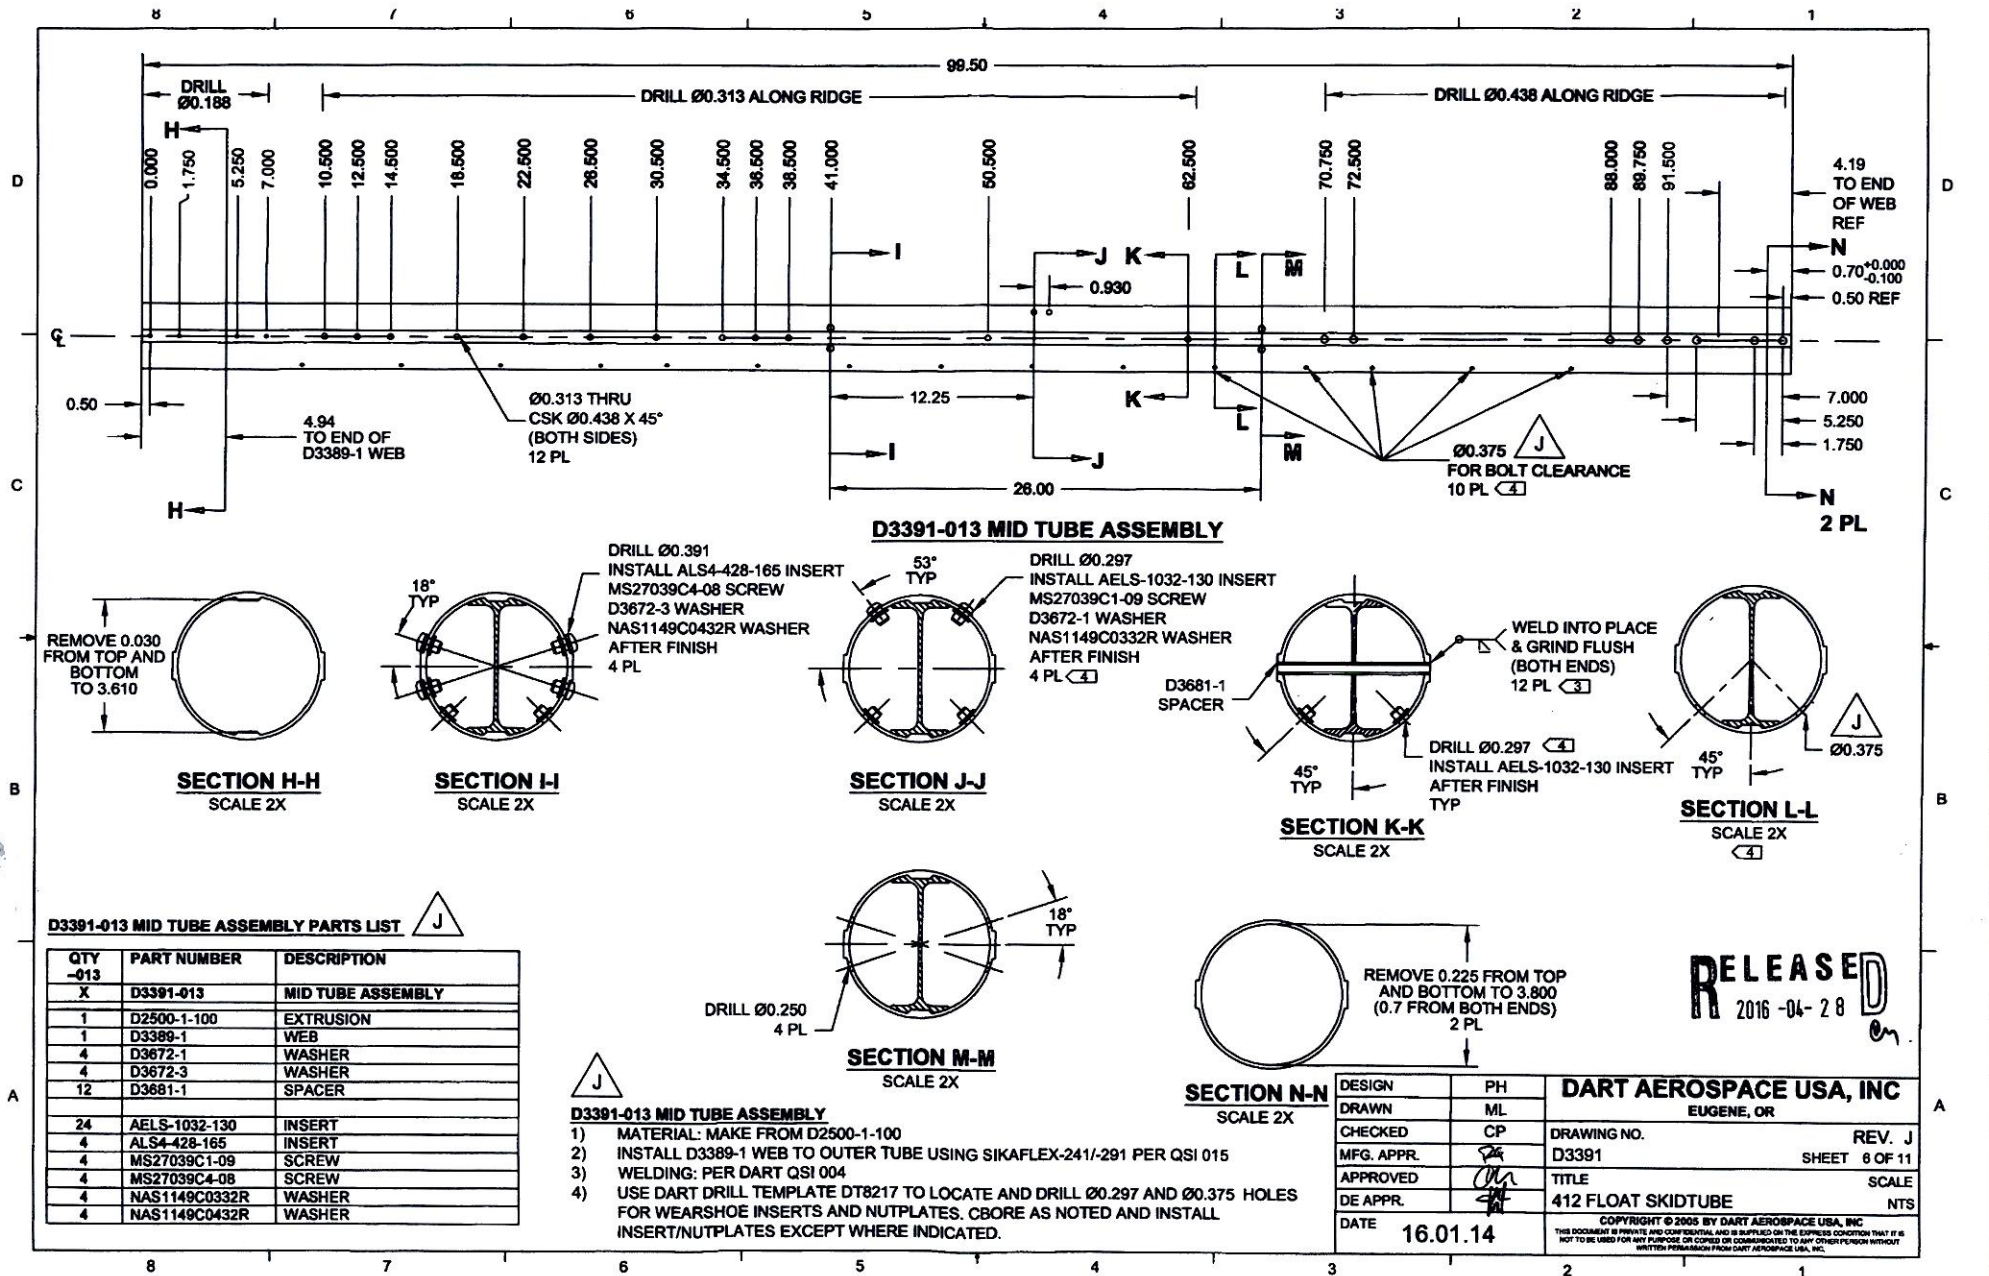

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

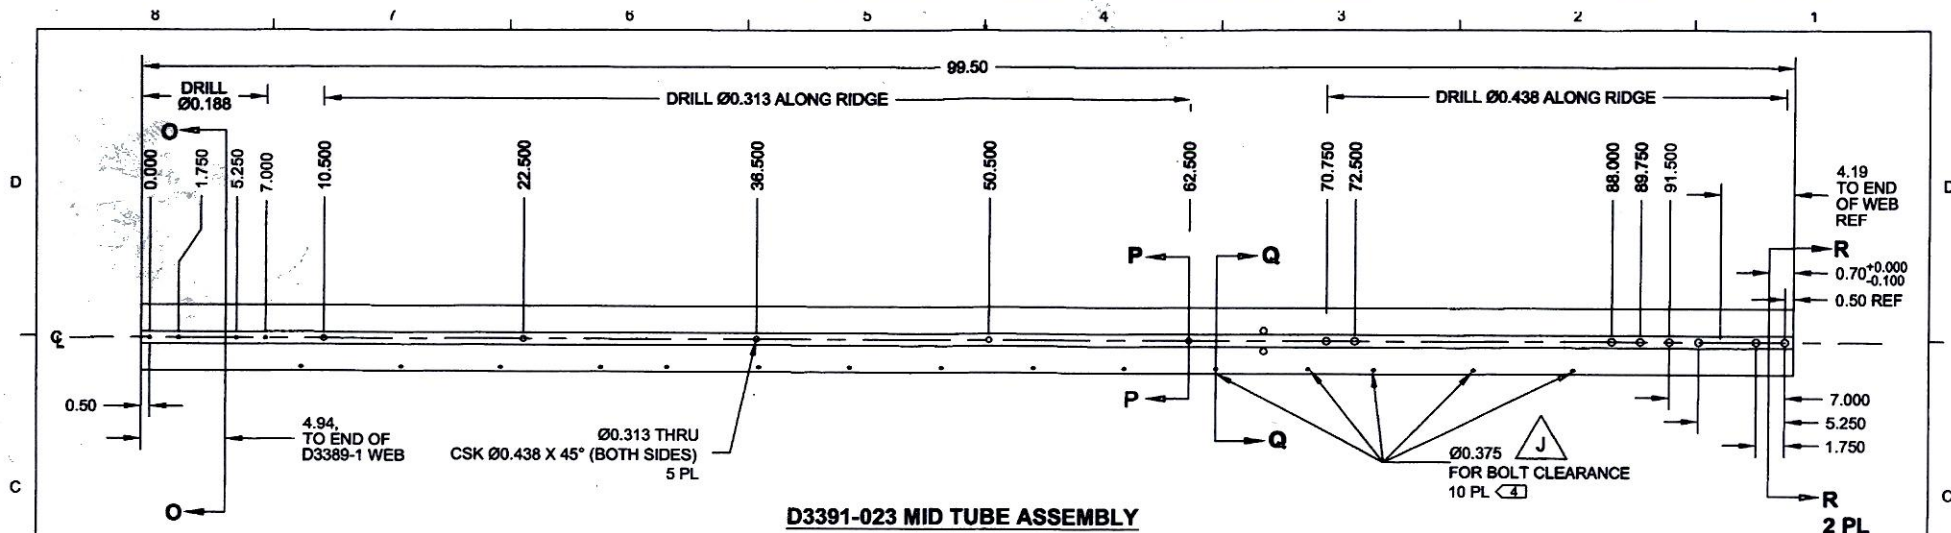


D3391-023 MID TUBE ASSEMBLY

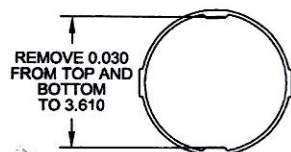


SECTION O-O
SCALE 2X

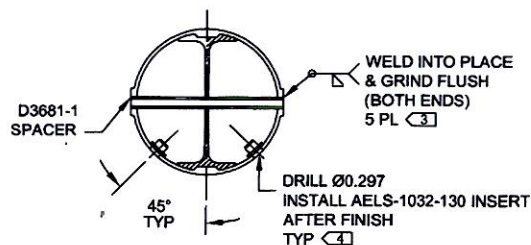

SECTION P-P
SCALE 2X

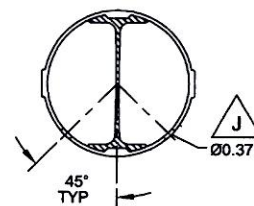

SECTION Q-Q
SCALE 2X <4>

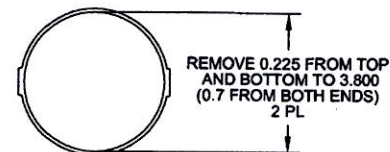

SECTION R-R
SCALE 2X

D3391-023 MID TUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
1	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT



D3391-023 MID TUBE ASSEMBLY

- 1) MATERIAL: MAKE FROM D2500-1-100
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER QSI 015
- 3) WELDING: PER DART QSI 004
- 4) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 AND Ø0.375 HOLES FOR WEARSHOE INSERTS AND NUTPLATES. BORE AS NOTED AND INSTALL INSERT/NUTPLATES EXCEPT WHERE INDICATED.

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.		D3391	SHEET 7 OF 11
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

RELEASED
2016-04-28

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabelled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER :					

DQA: _____ Date: _____





WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

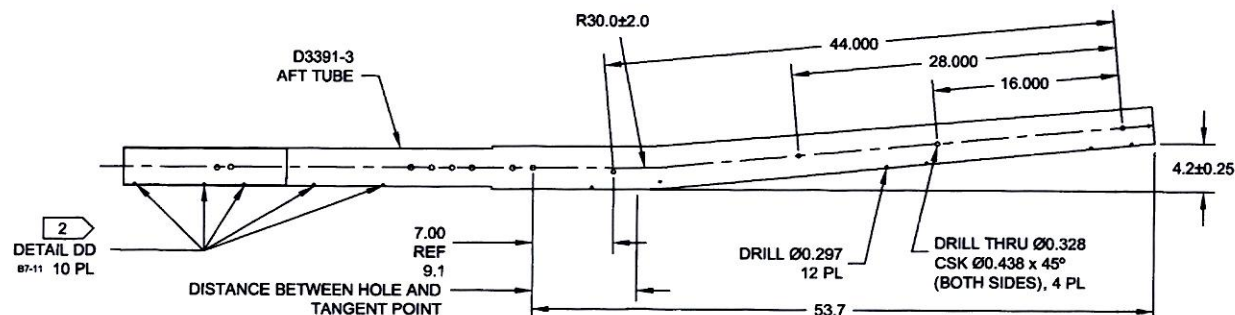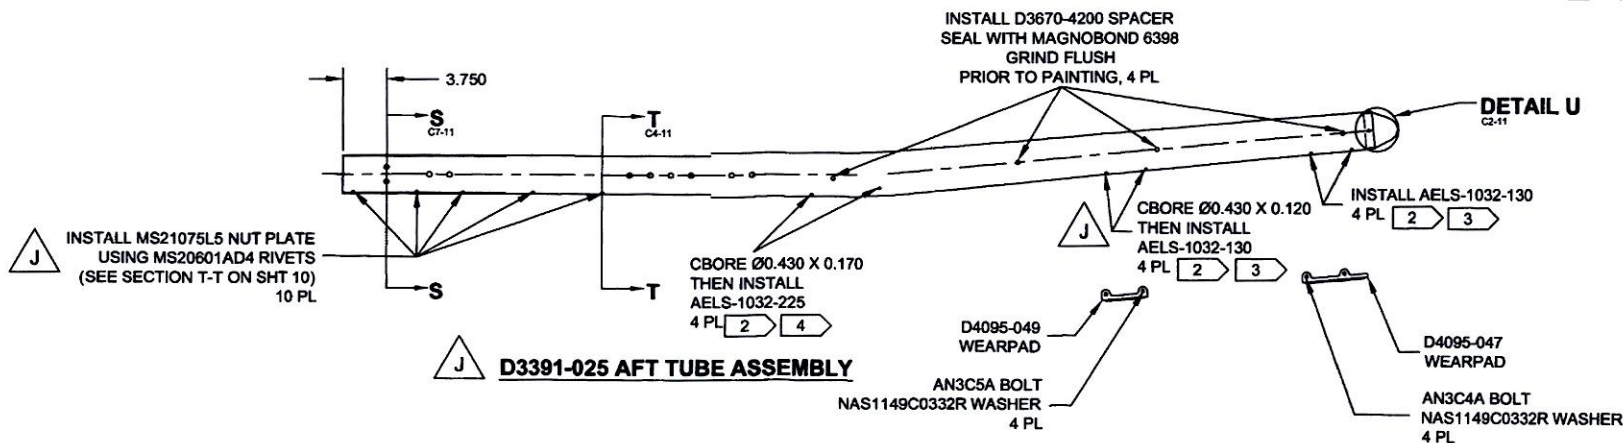

D3391-025 AFT TUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
X	D3391-025	AFT TUBE ASSEMBLY
1	D2646	AFT CAP
1	D3391-3	AFT TUBE
4	D3670-4200	SPACER
2	D3672-1	WASHER
1	D4095-049	WEARPAD
1	D4095-047	WEARPAD
8	AELS-1032-130	INSERT
4	AELS-1032-225	INSERT
6	AN3C4A	BOLT
4	AN3C5A	BOLT
20	MS20601AD4	RIVET, BLIND
10	MS21075L5	NUT PLATE FLOATING
10	NAS1149C0332R	WASHER

NOTES:

- 1) COAT ALL EXPOSED FASTENERS WITH LPS "LPS PROCYON"
- 2) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 AND Ø0.375 HOLES FOR WEARSHOE INSERTS AND NUTPLATES. CBORE AS NOTED AND INSTALL INSERT/NUTPLATES EXCEPT WHERE INDICATED. USE NUT PLATE DRILL JIG IF REQUIRED.
- 3) ENSURE WALL THICKNESS IS BETWEEN 0.070 AND 0.130 BEFORE INSTALLING INSERT
- 4) ENSURE WALL THICKNESS IS BETWEEN 0.130 AND 0.225 BEFORE INSTALLING INSERT

RELEASED
2016-04-28

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.		D3391	SHEET 9 OF 11
APPROVED		TITLE	SCALE
DE APPR.		AFT TUBE ASSEMBLY	NTS
DATE	16.01.14	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

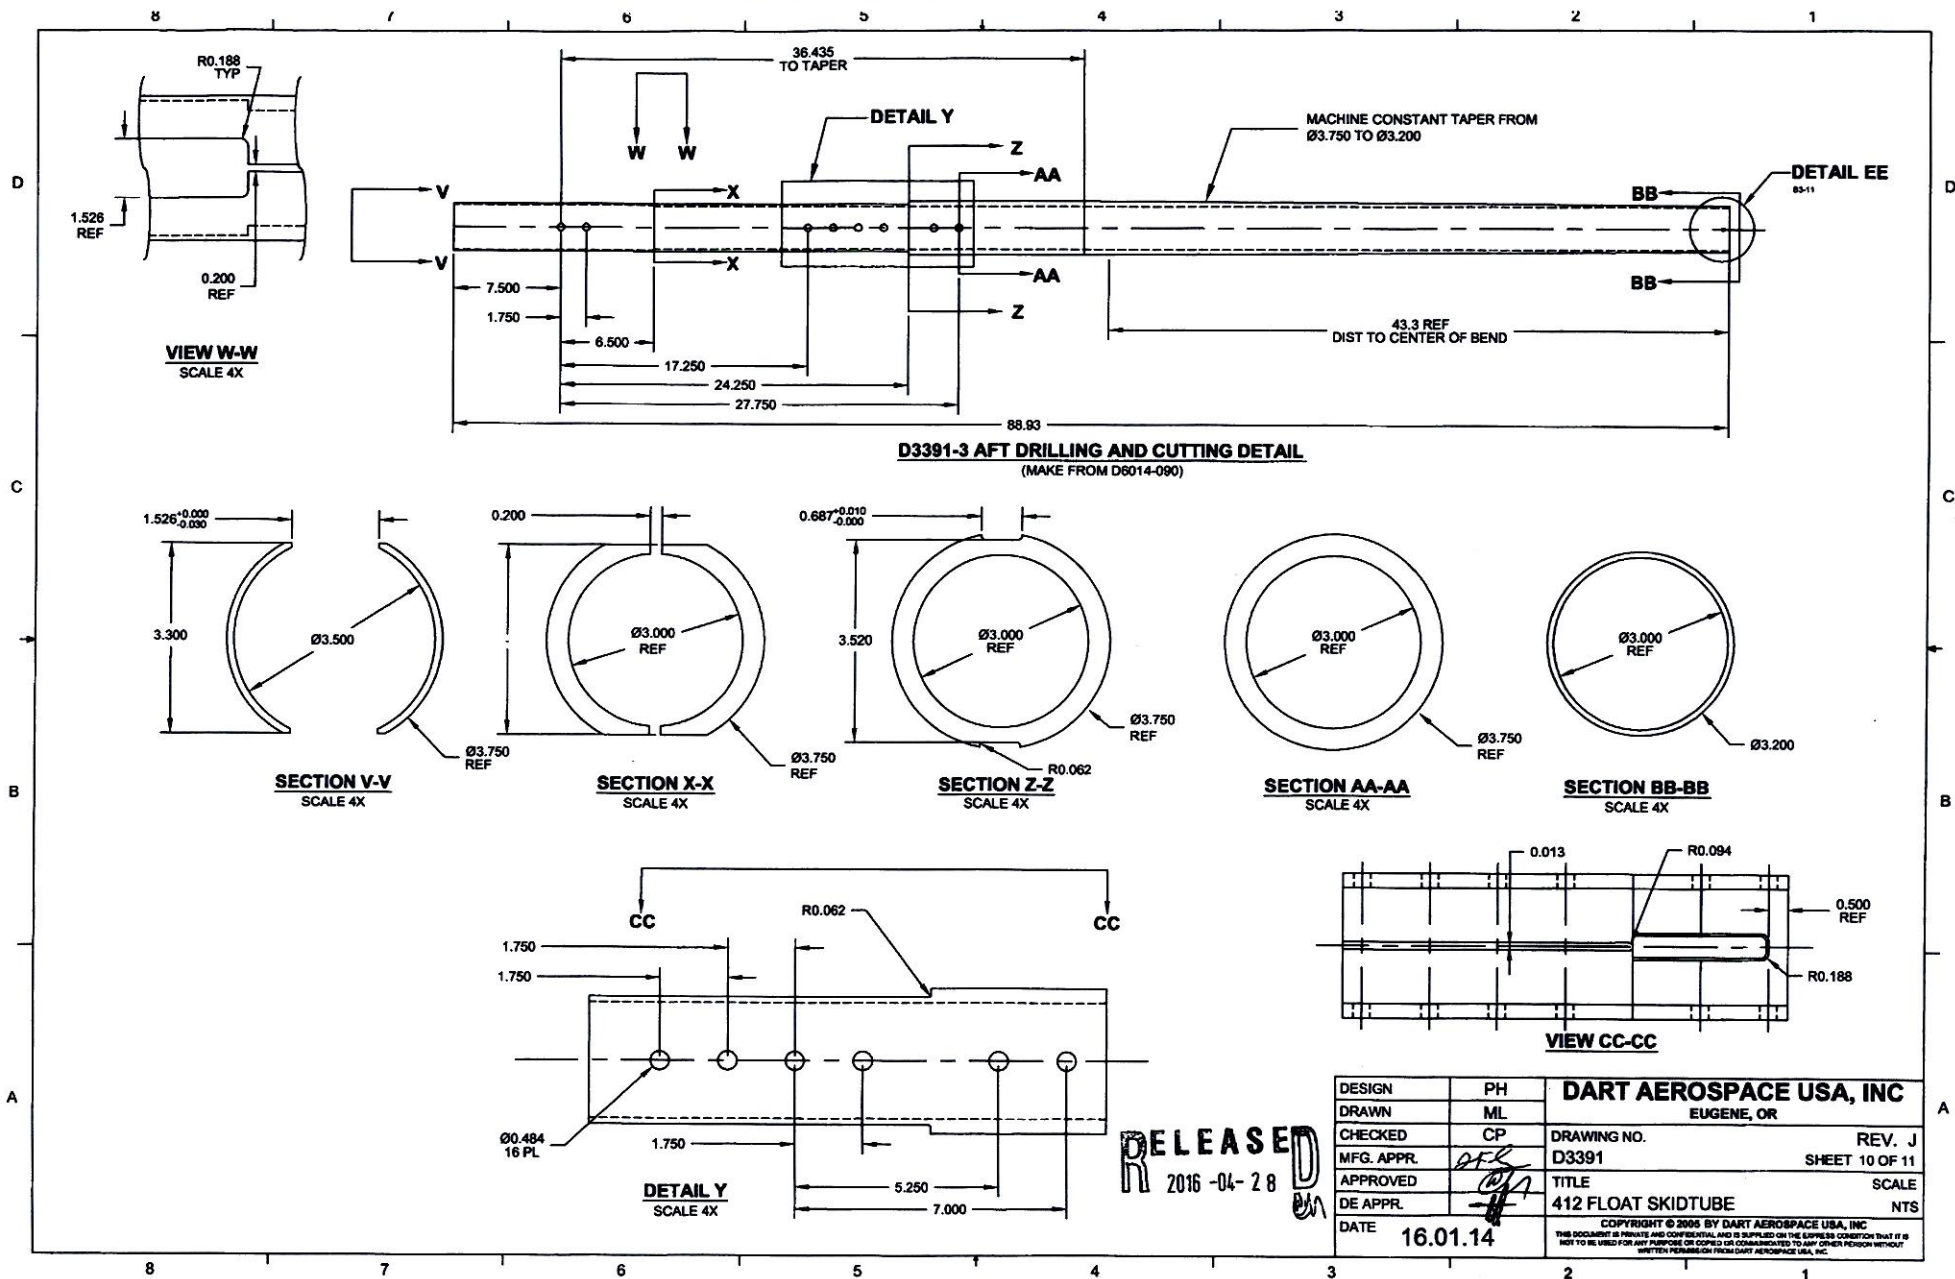

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.		D3391	SHEET 10 OF 11
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMERCIALIZED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐				
Date :	Step #:	QTY Effective :			MRB (QS1042) Approval	
Description Work Order Deviation		Disposition			Completed By	
					Lead hand / Supervisor Approval Verification	
					QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY				
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	
OTHER :						

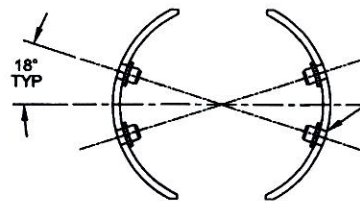


SECTION S-S D5-8.9
SCALE 5X


DRILL Ø0.391
CBORE Ø0.516 X 0.040 DEEP
INSTALL ALS4-428-165 INSERT
4 PL

USE DT8217 DRILL TEMPLATE
TO LOCATE HOLES AND OPEN
TO Ø0.375


MS21075L5 NUTPLATE
REF

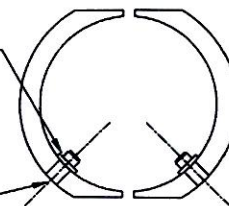


SECTION T-T D5-8.9
SCALE 5X
5 PL

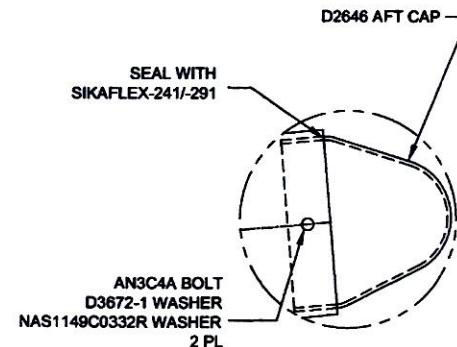

DETAIL U D1-8.9
SCALE 5X

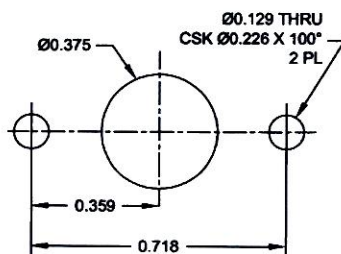

DRILLING DETAIL DD D7-8.9
SCALE 10X

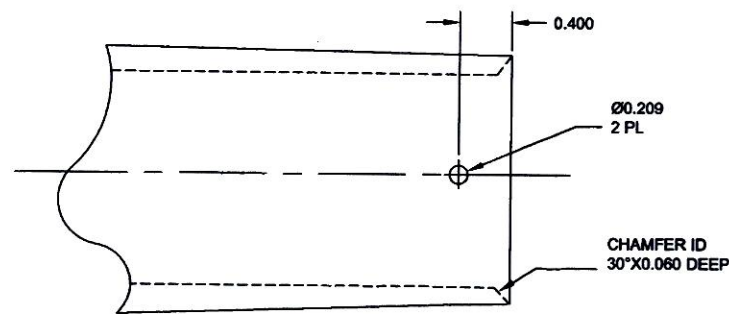

DETAIL EE D1-11
SCALE 2X

NOTES:
1) USE INDUSTRY STANDARD NUT PLATE DRILL JIG IF REQUIRED.

RELEASED
2016-04-28

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.		D3391	SHEET 11 OF 11
APPROVED		TITLE	SCALE
DE APPR.		AFT TUBE ASSEMBLY	NTS
DATE	16.01.14	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QS1042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause			FAULT CATEGORY		
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					